

Chemung County Stormwater  
Construction Inspection  
Erosion and Sediment Control

Project Name	Parmenter Tire	Date	6-16-14
Location	Horseheads Industrial Park	Permit #	NYR10X355
Weather Conditions	Sunny - warm	Entry Time:	10:57
On-Site Representative Present:		Exit Time:	

Sketch of Project site-Include Disturbed Areas:

Outlet structure - pipe has been grouted

Yes	No	N/A	
	/		All erosion and sediment control measures installed/constructed
	/		All erosion and sediment control measures maintained properly
	/		Are there currently more than 3 acres disturbed w/o prior approval
/			Have stabilization measures been initiated in inactive areas
/			Are permanent stormwater control measures being implemented
	/		Was there a discharge into the receiving water on the day of inspection
	/		Evidence of turbidity or oil in the receiving waters
			Are weekly inspections being performed?
			Are the inspections being performed by a qualified individual?

Comments:

- Check rain garden depth (15-20 in) May need to be more ~~open~~ shaped - check grades as well  
 - Parking lot from Parmenter tire expanded flows into pond.  
 \* Concrete washed out/off in stormwater basin. - Cannot be there -  
 - Swale above railroad crossing is not defined

Satisfactory

Marginal

Unsatisfactory

Date	6/16/14	Inspector	Jessica Varrigini
------	---------	-----------	-------------------



851 Chemung Street  
Horseheads, New York 14845  
Ph. 607.796.2216

<b>PROJECT:</b>	Parmenter
	Village of Horseheads
	Municipal Inspection
	June 16, 2014
<b>BY</b>	Jessica Verrigni, CPESC, CPSWQ



Area seeded and mulched.

Area seeded and mulched.



Rain Garden without mulch-6" depth is not achieved.



Stormwater forebay is holding water.





CHEMUNG  
COUNTY  
STORMWATER  
COALITION

851 Chemung Street  
Horseheads, New York 14845  
Ph. 607.796.2216

<b>PROJECT:</b>	Parmenter
	Village of Horseheads
	Municipal Inspection
	June 16 2014

<b>BY</b>	Jessica Verrigni, CPESC, CPSWQ
-----------	--------------------------------



Outlet pipe has been grouted.



Concrete was washed out onto the side slope of the stormwater pond.



Looks like new fill material from separate facility has been added and drainage flows directly into pond.



Swale is undefined and there is no rain garden installed.